

# **Restoring Fatigue Performance Of Corrosion Damaged Aa7075-T6 and Fretting in 4340 Steel with Low Plasticity Burnishing**

Paul S. Prevéy  
Lambda Research

John T. Cammett  
NAVAIR

## **ABSTRACT**

Corrosion related fatigue in aluminum structural alloys and fretting damage in high strength steels are primary failure mechanisms that reduce the structural integrity of aging aircraft. A chemically active environment, susceptible material and static and/or alternating tensile stresses are all required for failure. Conventional approaches to mitigate corrosion and fretting related failure mechanisms address either elimination of the corrosive environment with coatings, substitution or modification of alloys, or changes in design, all expensive solutions. This paper describes an alternate approach, employing surface enhancement by low plasticity burnishing (LPB) to introduce a deep, stable layer of compressive residual stress to eliminate the tensile stresses necessary for failure without altering either material or design.

The restoration of fatigue performance by LPB processing of severely salt fog pitted AA7075-T6 was previously described.<sup>1</sup> That work has been extended to investigate the effects of introducing a deep layer of compressive residual stress with LPB on the fatigue performance of AA7075-T6 prior to salt fog pitting, and prior to active corrosion fatigue in the absence of pitting, and prior to fretting of 4340 steel. The endurance limit of the baseline machined 7075-T6 surface was reduced from 205 MPa (30 ksi) to 103 MPa (15 ksi) by either 100 hr salt fog pitting or active corrosion in 3.5% NaCl during fatigue. LPB prior to corrosive exposure increased the endurance limit for 100 hr pitted samples to 310 MPa (45 ksi), and for active corrosion fatigue to 275 MPa (40ksi). LPB processing was performed in a conventional CNC machining center. LPB prior to fretting in 4340 steel increased the HCF strength 25%, eliminating the fretting fatigue debit. Surface enhancement of fatigue critical aircraft structural components with LPB offers a cost effective and practical alternative to alloy substitution or component re-design as a

means of improving the structural integrity of aging aircraft.

## **INTRODUCTION**

The pronounced fatigue strength reduction caused by salt corrosion pitting or corrosion fatigue in a marine environment is well established for aluminum alloys.<sup>2</sup> Corrosion pits are a common site of fatigue crack initiation in the aluminum alloy 7075-T6 used for aircraft structural components. Pitting arises from intergranular corrosion to a depth dependent upon the service environment and the time of exposure, i.e., age of the aircraft.

Fretting of high strength steels is an equally deleterious fatigue initiation mechanism. Fretting is a complex mechanical wear and oxidation process that ultimately leads to fatigue initiation from shear cracks that develop at the edges of the fretting scars. Fretting fatigue failures develop from vibration in engine and transmission components and occur in steel shafts and gearing as well as structural components, including landing gear. Both fretting and corrosion damage increase as aircraft age. The fatigue debit for either of these mechanisms is typically on the order of half of the endurance limit.

Annual costs for corrosion inspection and repair of Naval aircraft alone are estimated to exceed one billion dollars. By the year 2015 over 90% of military aircraft are expected to exceed 20 years of age.<sup>3</sup> A means of mitigating corrosion and fretting related fatigue damage is needed.

Low plasticity burnishing (LPB) can provide a layer of compressive residual stress of sufficient depth to effectively eliminate the fatigue debit from prior salt pit corrosion.<sup>1,4</sup> The LPB process can be performed on conventional CNC machine tools in a shop environment at speeds comparable to machining

Report Documentation Page				Form Approved OMB No. 0704-0188	
Public reporting burden for the collection of information is estimated to average 1 hour per response, including the time for reviewing instructions, searching existing data sources, gathering and maintaining the data needed, and completing and reviewing the collection of information. Send comments regarding this burden estimate or any other aspect of this collection of information, including suggestions for reducing this burden, to Washington Headquarters Services, Directorate for Information Operations and Reports, 1215 Jefferson Davis Highway, Suite 1204, Arlington VA 22202-4302. Respondents should be aware that notwithstanding any other provision of law, no person shall be subject to a penalty for failing to comply with a collection of information if it does not display a currently valid OMB control number.					
1. REPORT DATE <b>SEP 2002</b>		2. REPORT TYPE		3. DATES COVERED <b>00-00-2002 to 00-00-2002</b>	
4. TITLE AND SUBTITLE <b>Restoring Fatigue Performance of Corrosion Damaged Aa7075-T6 and Fretting in 4340 Steel with Low Plasticity Burnishing</b>				5a. CONTRACT NUMBER	
				5b. GRANT NUMBER	
				5c. PROGRAM ELEMENT NUMBER	
6. AUTHOR(S)				5d. PROJECT NUMBER	
				5e. TASK NUMBER	
				5f. WORK UNIT NUMBER	
7. PERFORMING ORGANIZATION NAME(S) AND ADDRESS(ES) <b>Lambda Research,5521 Fair Lane,Cincinnati,OH,45227</b>				8. PERFORMING ORGANIZATION REPORT NUMBER	
9. SPONSORING/MONITORING AGENCY NAME(S) AND ADDRESS(ES)				10. SPONSOR/MONITOR'S ACRONYM(S)	
				11. SPONSOR/MONITOR'S REPORT NUMBER(S)	
12. DISTRIBUTION/AVAILABILITY STATEMENT <b>Approved for public release; distribution unlimited</b>					
13. SUPPLEMENTARY NOTES <b>The original document contains color images.</b>					
14. ABSTRACT <b>see report</b>					
15. SUBJECT TERMS					
16. SECURITY CLASSIFICATION OF:			17. LIMITATION OF ABSTRACT	18. NUMBER OF PAGES <b>7</b>	19a. NAME OF RESPONSIBLE PERSON
a. REPORT <b>unclassified</b>	b. ABSTRACT <b>unclassified</b>	c. THIS PAGE <b>unclassified</b>			

operations. The residual stress distributions developed by LPB in nickel<sup>4</sup>, titanium<sup>5</sup>, and aluminum alloys and steels exceed 1 mm (0.04 in.) in depth, well beyond the depth of typical corrosion pits, which serve as the initiation sites for fatigue cracks.

The effect of LPB applied after corrosion pitting of AA7075-T6, simulating an overhaul operation, has previously been shown to fully restore the corrosion fatigue debit.<sup>6</sup> The current investigation addresses the effect of LPB processing prior to pitting corrosion or corrosion fatigue in 7075-T6 and applied to 4340 steel prior to fretting damage.

## EXPERIMENTAL TECHNIQUE

### **Material**

Aluminum alloy 7075-T6 was acquired in the form of 13 mm (½ in.) plate to AMS 4045. In the -T6 heat-treated condition, the material was found to have a hardness of 89 HRB and electrical conductivity of 33.0% IACS. Chemistry was verified to be within limits of the AMS 4045 specification. Tensile properties were verified as UTS=601 MPa (87.3 ksi), 0.2% yield strength of 542 MPa (78.7 ksi) with an elongation of 11%.


4340 steel was procured to AMS 6415 as rectangular bar stock nominally 13 X 75 mm (0.5 x 3.0 in.). The stock was cut to length, quenched, and tempered to a hardness of 40-44 HRC. The tensile properties were UTS=1336 MPa (194 ksi) and 0.2% YS=1240 MPa (180 ksi), with an elongation of 14%.

### **Low Plasticity Burnishing**

Low plasticity burnishing (LPB) produces a layer of compressive residual stress of high magnitude and depth with minimal cold work.<sup>7</sup> The process has been described in detail previously,<sup>8</sup> as characterized by a single pass of a smooth free rolling ball under a normal force sufficient to plastically deform the surface of the material. Hertzian loading creates a layer of compressive residual stress to a depth as deep as 4 mm (0.16 in.). The ball is supported in a fluid bearing with sufficient pressure to lift the ball off the surface of the retaining spherical socket. The ball is in solid contact only with the surface to be burnished and is free to roll on the surface of the work piece.

Using CNC positioning, the tool path is controlled so that the surface is covered with a series of passes at a separation maintained to achieve maximum compression with minimum cold working. The tool may be moved in any direction along the surface of a complex work piece, as in a typical multi-axis CNC machining operation. The LPB processing of fatigue

specimens used in this investigation is depicted in Figure 1.

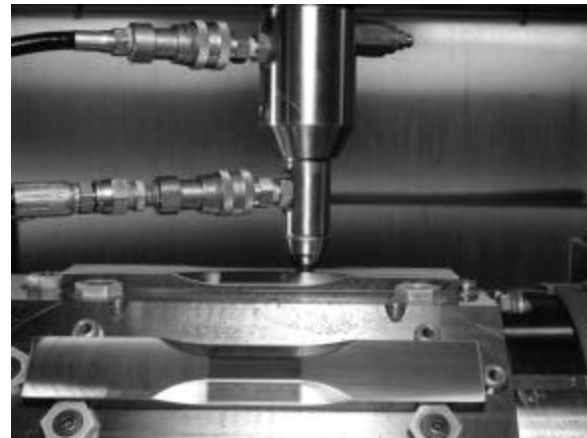

**Figure 1** – LPB processing of fatigue samples with at single point contact LPB tool in a 4-axis CNC mill.

### **X-ray Diffraction Surface Characterization**

Diffraction peak broadening, measured along with the residual stress, allows the amount of damage developed by surface enhancement methods to be accurately assessed. The method of quantifying the degree of cold working of metals, by relating the x-ray diffraction peak broadening to the equivalent true plastic strain, has been described previously.<sup>9</sup> The distribution of cold work as a function of depth into the deformed surface can be expressed in terms of the equivalent true plastic strain. If the degree of cold work is taken to be the equivalent amount of true plastic strain, the degree of cold work is then cumulative and is independent of the mode of deformation. Thus, the subsurface yield strength distribution can then be estimated from true stress-strain curves.<sup>10</sup> The macroscopic residual stress, of primary interest in design and life prediction, is determined in the conventional manner from the shift in the diffraction peak position.<sup>11,12,13</sup>

### **High Cycle Fatigue Testing**

Four-point bending was the HCF testing mode selected to provide maximum sensitivity to the surface condition.<sup>14</sup> Fatigue testing was conducted at room temperature under constant sinusoidal load amplitude at 30 Hz, R=0.1. Fatigue data were developed as S/N curves of nominally eight samples each.

The 7075-T6 HCF samples were finish machined by milling using conventional end milling to simulate the surface conditions including residual stress and cold work that would be present on a machined structural aircraft component. S/N curves for 7075-T6

were prepared for the following combinations of surface condition, corrosion damage, or corrosive environment:

1. Machined baseline
2. Machined + LPB + 100hr salt fog
3. Machined + LPB + active corrosion fatigue

The 4340 steel samples were finished by low-stress grinding to simulate typical manufacturing operations used to finish high strength steels. 4340 steel S/N curves were then prepared for the following conditions:

1. Ground
2. Ground + fretting
3. Ground + pre-fretting + fretting
4. Ground + LPB
5. Ground + GBP + LPB
6. Ground + fretting + GBP + LPB + fretting

The glass bead peening (GBP) was intended to simulate blast cleaning of steel surfaces commonly performed in aircraft overhaul. The multiple fretting stages were designed to simulate fretting in service, LPB during overhaul (or not), and then continued fretting upon return to service. Pre-fretting was performed at a stress level slightly above the ground sample baseline for 30,000 cycles and then terminated. Previous work has shown that primary fretting damage occurs within this initial stage of fatigue exposure.<sup>15</sup> Fretting was again applied to the same location during fatigue testing of multiple fretting cycles.

### ***Corrosion and Fretting Exposure***

The 7075-T6 salt fog corrosion samples were exposed at 35° C per ASTM B117 for a period of 100 hours. The pH of the solution was maintained between 6.5 and 7.2. Following exposure to the salt fog, any residual salt was removed by soaking and then rinsing the samples in tap water, followed with a distilled water rinse. Patches of gray and white corrosion product evident on the surface of the samples were identified by xray diffraction as  $\alpha$ - $\text{Al}_2\text{O}_3$ . The corrosion product was not removed prior to fatigue testing.

The 7075-T6 active corrosion fatigue tests were conducted with the sample gage section wrapped in a chemical-free laboratory tissue saturated with 3.5-wt% NaCl solution and sealed with polyethylene film and vinyl to avoid evaporation. The saturated tissue served as a wick to maintain the salt solution in contact with the sample surface.

Fretting damage was produced in the 4340 steel samples by pressing a 4340 steel cylindrical pad of 25 mm (1.0 in.) radius into the active gage section of the fatigue specimen during cyclic loading. A constant normal (clamping) force of 845N (190 lbs) produced a nominal contact stress of 275 MPa (40 ksi) over the region of contact. The clamping fixture was instrumented with strain gages and calibrated to monitor the normal force during testing. The force was found to be essentially constant after the first few loading cycles. The initial reduction in normal force of a few percent was attributed to the wearing of aspirates on the machined or ground surfaces.

## **RESULTS AND DISCUSSION**


### ***Residual Stress Distributions***

The residual stress distributions developed by machining and LPB processing of 7075-T6 are shown in Figure 2. Machining of 7075-T6 produced low tension on the surface and compression of less than -68 MPa (-10 ksi) below the surface. In contrast, LPB produced maximum compression on the order of -480 MPa (-70 ksi) between the surface and a depth of nominally 0.2 mm (0.008 in.). Maximum cold work occurs from the surface through the region of maximum compression, and then diminishes with depth. X-ray diffraction measurement could not be made reliably below a depth of 0.5 mm (0.02 in.) in the 7075-T6 because of the coarse grain size encountered at depths beneath the deformed surface layer.


Residual stress and cold work distributions produced by grinding and LPB of 4340 steel are shown in Figure 3. Low stress grinding alone left the surface slightly compressive, with a subsurface peak compression on nominally -350 MPa (-50.8 ksi). Grinding and glass bead peening (GBP) of 4340 steel produced surface compression on the order of -500 MPa (-72.6 ksi) and a compressive layer not exceeding a depth of 75 $\mu\text{m}$  (0.003 in.). LPB produced a compressive layer with a maximum of nominally -100 MPa (-14.5 ksi) at the surface and extending over 1 mm (0.04 in.) into the surface.

No attempt was made to optimize the LPB parameters to achieve a specific level of residual stress or cold work that would provide the best fatigue performance. The parameters were simply chosen, based upon prior experience, to produce a deep layer of compression with available tooling. Optimizing the combination of LPB parameters

(including normal force, ball size, ball modulus, and feed) allows the residual stress and cold work distributions to be tailored to the application.

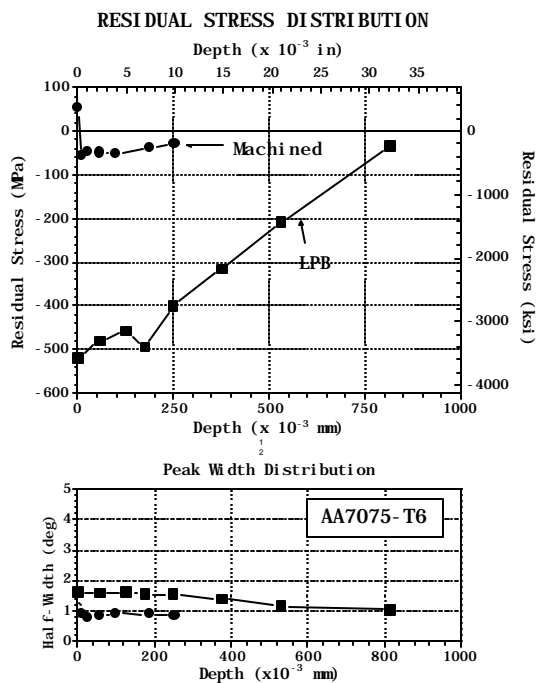

**Figure 2** - Residual stress and half width distribution in machined and LPB processed AA7075-T6.

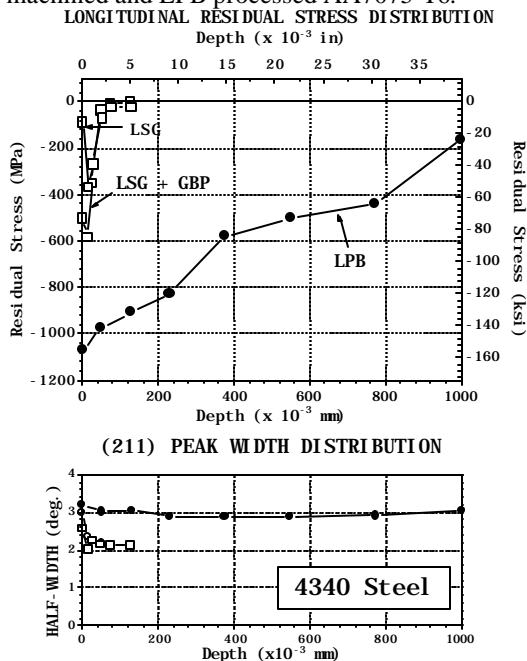

**Figure 3** - Residual stress and diffraction peak half-width distributions of low stress ground (LSG), glass bead peened (GBP) and low plasticity burnished (LPB) 4340 steel.

### Corrosion and Fretting Damage

Corrosion of the 7075-T6 only during fatigue testing was termed “active corrosion” for the purposes of this study, to indicate that the corrosion process was active only during cyclic loading, resulting in “corrosion fatigue”. In contrast, salt fog exposure prior to fatigue testing produced pitting damage, but the process was not active during fatigue loading. Fatigue testing then measures the effect of the prior damage, and the fatigue cracking process is not assisted by corrosion.

Macroscopic and fractographic examination of the exposed surfaces revealed that 100 hr salt fog exposure of the machined surface resulted in uniform corrosion of the test surfaces. Pit depths averaged 100 $\mu$ m to 120 $\mu$ m (0.004 to 0.005 in.). After penetration of the surface, the corrosion crevices often were observed to progress laterally, thereby delaminating layers of material, apparently following the elongated grain boundaries produced by rolling of the plate.

Shallower pitting was observed on the surfaces that received LPB after machining (and prior to salt fog exposure) than those machined surfaces directly exposed. Pits formed on the LPB surfaces after 100 hr salt fog exposure had irregular, near circular shapes with a 34 $\mu$ m (0.0013 in.) average depth and a nominal 44 $\mu$ m (0.0017 in.) diameter. This is nominally one-third the depth of pitting observed for the machined samples.


Active corrosion at ambient temperature during cyclic loading produced much shallower pits than 100 hr salt fog exposure at 35C. This was true even for active corrosion fatigue samples given the maximum exposure for the full  $10^7$  cycles to run-out, or 108 hours of testing in 3.5% NaCl solution. For both the machined and LPB surfaces, the pits were nominally 9 $\mu$ m (0.0003 in.) deep, and were numerous across the entire exposed surface. Pits on the machined surface tended to be circular with nominal diameter of 5 $\mu$ m (0.0002 in.). Pits on the LPB surface tended to be irregular and interconnecting to extend up to 20 $\mu$ m (0.0079 in.).

Fretting of the 4340 steel produced a fretting scar in the form of a narrow band of black oxidation on the surface nominally 1 mm (0.04 in.) wide, but varying with the applied stress and strain range. The depth of the fretting scars was shallow, insufficient to remove the surface marks left by grinding. Because the fretting was generated by a pad clamped to the surface of the cyclically strained fatigue sample, the

width of the fretting scar was dependent upon the strain range of the test. Fatigue cracks initiated from the edges of the scars at the point of maximum shear stress under contact loading.

### HCF Performance

The S/N curves generated for 7075-T6 in both the baseline (as-machined) and LPB conditions, after 100 hr salt fog exposure or active corrosion fatigue, are presented in Figure 4. Fatigue tests were continued for a minimum of  $2.5 \times 10^6$  cycles with a maximum run-out at  $1.2 \times 10^7$  cycles. The fatigue data are presented as semi-logarithmic S/N curves in terms of the maximum stress.

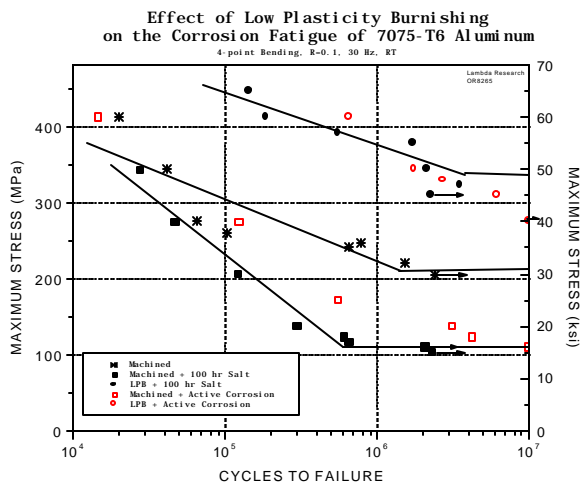

**Figure 4** - High cycle fatigue results for salt fog pitted and active corrosion fatigue of machined 7075-T6 with and without LPB processing prior to exposure to corrosion.

The S/N curves for samples with pitting from prior salt fog exposure appeared to exhibit an endurance limit, implying infinite life below some threshold stress level. The S/N curves for samples exposed to active corrosion fatigue during testing do not appear to have an endurance limit, as is commonly observed in studies of corrosion fatigue.<sup>16</sup> In the discussion that follows, the results are considered and compared in terms of the fatigue life at nominally  $2 \times 10^6$  cycles.

The machined (end milled) surface condition produced an apparent endurance limit on the order of 200 MPa (30 ksi). Salt fog exposure for 100 hrs reduced the endurance limit to nominally 100 MPa (15 ksi), half that of the original machined surface


before exposure to salt fog generated pitting corrosion. Loss of nominally half the extended life fatigue strength following salt fog corrosion pitting appears to be typical of the degradation reported in the literature<sup>3</sup>. The fractional loss of fatigue life at stress levels above the endurance limit increased rapidly as the maximum stress level reduced, reaching an order of magnitude at the 200MPa (30ksi) endurance limit

Active corrosion fatigue in 3.5% NaCl solution, with no prior corrosion damage, degraded the fatigue strength relative to the as-machined condition by an amount only slightly less than prior pitting corrosion up to a life of  $10^7$  cycles. A failure occurred in active corrosion fatigue at the nominal 100 MPa (14.5 ksi) endurance limit for pitting corrosion. The data appear to suggest further reduction in fatigue strength with increasing life and the absence of an endurance limit for active corrosion fatigue of the machined 7075-T6 surface.

LPB prior to salt fog pitting resulted in a 70% increase in the endurance limit, from nominally 200 MPa (30 ksi) to over 330 MPa (48 ksi). LPB prior to corrosion increased the fatigue life at stress levels above the endurance limit 310 MPa (45 ksi) by two orders of magnitude, or one hundred times that of the baseline machined surface.


A comparable benefit in fatigue performance was observed for LPB prior to active corrosion fatigue in 3.5% NaCl solution. As noted earlier, a true endurance limit may not exist for the active corrosion fatigue mechanism; however, the fatigue strength at  $10^7$  cycles was at least 282MPa (41ksi). Fatigue lives were 100 times that of the baseline for stress levels above 275 MPa (40 ksi).

Fractographic analysis revealed that all of the fatigue failures in specimens without prior LPB, whether exposed to salt fog pitting or active corrosion fatigue, initiated at the surface. A typical surface fatigue initiation site is shown in Figure 5. All of the salt fog pitted sample initiations were exclusively from corrosion pits, as observed previously<sup>6</sup>. Specimens tested at lower stresses generally exhibited origins from a single pit or surface location, while specimens tested at higher stress levels tended to have multiple nucleation sites.

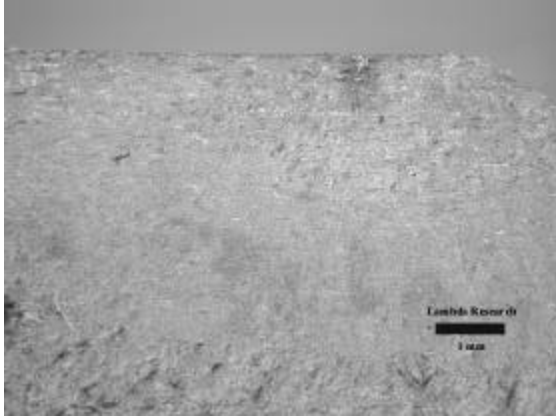

**Figure 5** – Typical surface fatigue initiation site on machined 7075-T6 in active corrosion fatigue.

The effect of the layer of high residual compression produced by LPB was to drive fatigue origin below the surface by as much as 1mm (0.04 in.) All of the fatigue cracks in the LPB + salt fog pitted 7075-T6 samples originated not at the damaged surface, but subsurface. The stress below the compressive layer simply exceeded the fatigue endurance limit. As the fatigue failures did not originate in the LPB processed surface, the fatigue results can only be interpreted as indicating that the LPB surface has even higher fatigue strength than indicated.

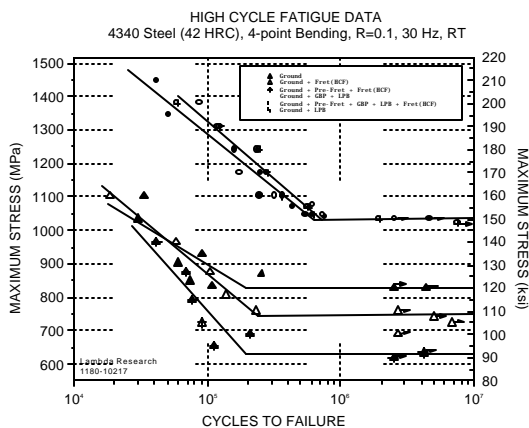


**Figure 6** – 4340 steel fretting fatigue results, as ground and with prior LPB treatment. Multiple fretting exposures simulate service damage, overhaul, and return to service.

The fretting fatigue results for 4340 steel are shown in Figure 6. The ground baseline samples produced an endurance limit of 827 MPa (120.0 ksi). Fretting of as-ground samples during fatigue testing reduced the endurance limit to nominally 758 MPa (110.0 ksi).

Pre-fretting followed by fretting during fatigue testing (simulating returning a fretted part to continued service) reduced the HCF endurance limit further to nominally 620 MPa (90.0 ksi), a loss of 25% of the initial fatigue strength.

LPB, either before or after fretting, produced an endurance limit of nominally 1033 MPa (150.0 ksi), 25% higher than ground 4340 without fretting damage. Even with fretting both before and after LPB, intended to simulate application of LPB of a component during overhaul followed by return to service, LPB gave the same 25% endurance limit increase, indicating complete mitigation of the fretting fatigue debit.

Fatigue initiated from the edge of the fretting scar in all of the 4340 samples without LPB. A typical fracture face, with the fretting scar visible at the top, is shown in Figure 7. Fatigue initiated in all of the LPB samples subsurface, just below the compressive layer, indicating a fatigue strength for the LPB surface higher than indicated by the results. The subsurface failures are interpreted as a limitation of the test technique and sample design which combined to allow the maximum tension to occur below the highly compressive test surface.

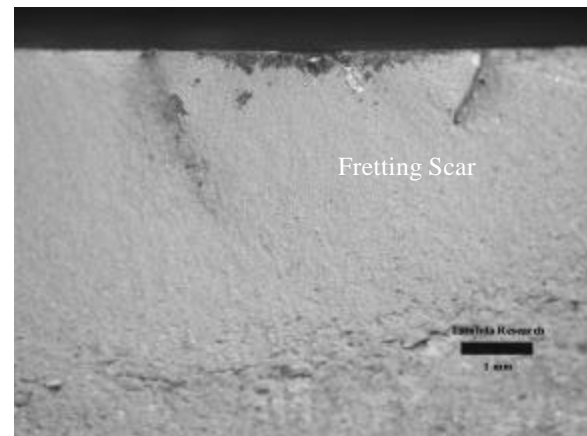

**Figure 7** – Fracture face of a 4340 steel fretting fatigue sample showing initiation from the edge of the fretting scar.

## CONCLUSIONS

The fatigue performance of the marine corrosion sensitive aluminum alloy 7075-T6 is greatly improved by low plasticity burnishing (LPB) prior to exposure to either salt fog pitting or active corrosion fatigue in 3.5% NaCl solution. Both corrosion mechanisms reduced the fatigue endurance limit of machined (end milled) 7075-T6 to half of the original fatigue strength.

LPB prior to exposure to either corrosion mechanism increased the HCF strength to over three times the strength of a corroded machined surface and 150% of the strength of the non-corroded machined surface. The fatigue life of 7075-T6 exposed to either corrosion mechanism at stress levels above the endurance limit is at least 100 times greater with prior LPB processing.

LPB has been shown to completely mitigate fretting damage in 4340 steel, even when applied after initial fretting damage. The fatigue strength with LPB was 25% higher than the original ground surface and 50% higher when repeated fretting damage, simulating a return to service, is encountered.

The improvement in fatigue life and strength for both alloys is attributed to the introduction of a layer of residual compression with a magnitude and depth sufficient to suppress fatigue crack initiation and propagation. The magnitude and depth of compression are sufficient to close shallower cracks emanating from corrosion pits and fretting scars, rendering them innocuous and altering the mode of fatigue crack nucleation and growth.

LPB has been demonstrated to substantially improve the fatigue performance the aluminum alloy 7075-T6 in corrosion fatigue and fretting 4340 steel. Applied locally to highly stressed fatigue prone locations in aging aircraft, LPB could extend the useful life of aging aircraft components limited by corrosion or fretting fatigue.

## REFERENCES

- 1 P. Prev  y and J. Cammett, "Low Cost Corrosion Damage Mitigation and Improved Fatigue Performance of Low Plasticity Burnished 7075-T6," *J. of Mat. Eng. and Performance*, ASM, (2001) p 548-555
- 2 N.E. Dowling, Mechanical Behavior of Materials, Prentice Hall, NJ, 1993, p. 365.
- 3 V.S. Agarawala, "Corrosion and Aging: Aircraft Concerns," presentation at 11th Annual AeroMat Conference, Bellevue, WA, June 26-29, 2000.
- 4 P.S. Prev  y, J. Telesman, T. Gabb, P. Kantzos, "FOD Resistance and Fatigue Crack Arrest in Low Plasticity Burnished IN718," Proceedings of the 5th Nat. Turbine Eng. HCF Conference, 2000.
- 5 P.S. Prev  y, and M.J. Shepard, "Surface Enhancement of Ti-6Al-4V Using Low Plasticity Burnishing," Presentation at 11th AeroMat Conference, Bellevue, WA, June, 2000.
- 6 P. Prev  y, "Low Cost Corrosion Damage Mitigation and Improved Fatigue Performance of Low Plasticity Burnished 7075-T6," Proc. 4<sup>th</sup> International Aircraft Corrosion Workshop, Solomons, MD, Aug. 22-25, 2000.
- 7 U.S. Patent 5,826,453 (Oct. 1998), other patents pending.
- 8 P. Prev  y, "The Effect of Cold Work on the Thermal Stability of Residual Compression in Surface Enhanced IN718," Proc. 20<sup>th</sup> ASM Materials Solutions Conf. & Expo, St. Louis, MO, Oct. 10-12, 2000.
- 9 P. Prev  y, "The Measurement of Subsurface Residual Stress and Cold Work Distributions in Nickel Base Alloys," Residual Stress in Design, Process & Materials Selections, ed. W.B. Young, Metals Park, OH: Am. Soc. For Metals, 1987, p 11-19.
- 10 P. Prev  y, P. Mason, D. Hornbach, & J. Molkenh  n, "Effect of Prior Machining Deformation Upon the Development of Tensile Residual Stresses in Weld Fabricated Nuclear Components," *Journal of Materials Engineering and Performance*, Vol. 5, 1, February 1996, p. 51-56.
- 11 P.S. Prev  y, Metals Handbook, Vol 10, ASM, Metals Park, OH, (1986), p. 380-392.
- 12 M.E. Hilley, ed, Residual Stress Measurement by XRD, SAE J784a, SAE, Warrendale, PA (1971)
- 13 Noyan & Cohen, Residual Stress Measurement by Diffraction & Interpretation, Springer-Verlag, NY, (1987)
- 14 P. Prev  y, W.P. Koster, "Effect of Surface Integrity on Fatigue of Standard Alloys at Elevated Temperatures," Fatigue at Elevated Temperatures, ASTM STP561, ASTM, Phil., PA, (1972)pp. 522-531.
- 15 N.E.Frost, K.J.Marsh, and L.P. Pook, Metal Fatigue, Dover, NY, 1974, p 368
- 16 N.E.Frost, K.J.Marsh, and L.P. Pook, Metal Fatigue, Dover, NY, 1974, p 105-112